



GENUINE MOTOR PARTS AND MOTOR ACCESSORIES BULLETIN

P&A NO. 661

DATE: 02/09/2000



Fitment of Screamin' Eagle XL Camshafts in 2000-later Vehicles

Fitment Information

The current SE camshafts and camshaft kits P/N's 25649-91, 25647-91A, and 25648-91 will not work in 2000 and later Sportsters in their current configuration due to a change in the gear manufacturing process. To update these kits to fit 2000 models, you need to add the following two part numbers:

For Camshaft Kits

25649-91
25648-91
25647-91A

Add Following 2 Items on 2000 and later XL's

24059-91 Pre-2000 Pinion Gear (recommended)
&
25263-90C Camgear Cover Gasket

Instruction Sheets

The current instruction sheets reference an older version of the cam gear cover gasket that should not be used in 2000 and later XL's. The instruction sheets are being updated to include notes for the gasket and pinion gear.

Potential Geartrain Noise

Finally, one of the driving forces to go to high contact ratio gears was to reduce gear noise in the XL geartrain. By changing the pinion gear back to the 1999 and earlier version, there is the potential for increased geartrain noise when installing these cams.

